





Z-LYFTEN PRODUKTION AB

Blankettnr: BL10050
Utförd av: FN
Datum: 050114
Utgåva: 2

Service Message

2019-01-17

Regarding: Solenoids

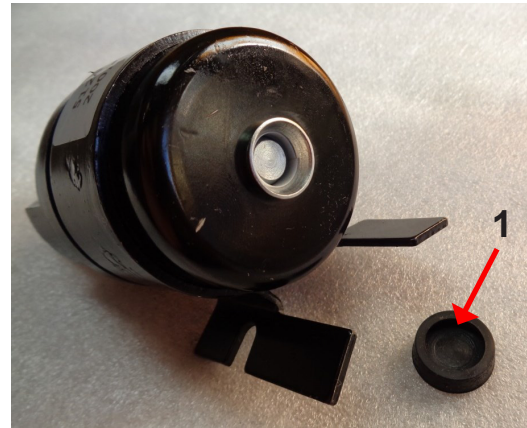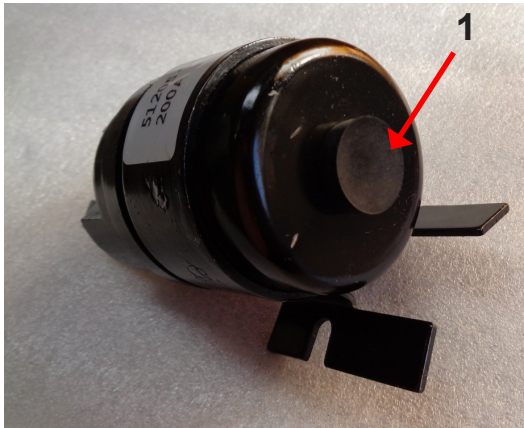

Replace solenoids with lost sealing.

If the rubber seal (1) on the solenoid is gone, the inside of the solenoid is unprotected and it is exposed to moisture and dirt. This leads to rust and an unreliable function. Among other things, the magnetic strength inside the solenoid becomes too weak (one can hear a chattering sound) and the solenoid eventually cannot handle to start the electric motor.

If the rubber seal is gone, we recommend you to replace the solenoid to prevent downtime.

*Note that previously sent out service messages are available at our website and in the C-files.
www.zepro.com, www.c-office.com*

Best Regards,
Zepro Z-Lyften Produktion AB

Christer Mattsson